Product group:	Electric Tool
Bulletin No:	2022.01.00000001
Created on:	07/09/2022
Published:	◉ Internally[1]　○ Distributors[2]　○ Sales companies[3]　○ Dealers[4]　◉ Service Centers[5]
Subject:	Different Motor & Electronic (Switch) used in Production on RBC36X26B & RBC36X26E

Specifications:

On the Zero Brush Cutter "**RBC36X26** was introduced a new Electronic Switch **5131035037** & a new (longer) Motor in Production, from old Motor **5131035048** to new Motor **5131041267**.
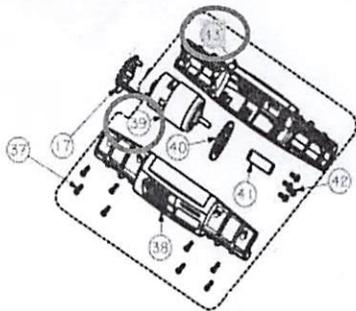All new spare parts are in the ELC Warehouse available.

Affected Tools:

RBC36X26B / 5133001813 / 090923001DG9
RBC36X26E / 5133001851 / 090923003DG9
RBC36B26C / 5133002405 / 4000444834
RBC36C38 / 5133002768 / 4000444915

Umbauanleitung

Affected Spare Part :

old Motor 5131035048 <u>switch to new</u>

Motor 5131041267 (pos. 39) + new Housing 5131035051 (pos. 43)

Solution for old Motor repair: In case of a Motor exchange on Code 5131035048 please use new Motor Code **5131041267** in addition with the Housings, **5131035051**

(In Code 5131035051 are both Housing halfs (left + right) included)
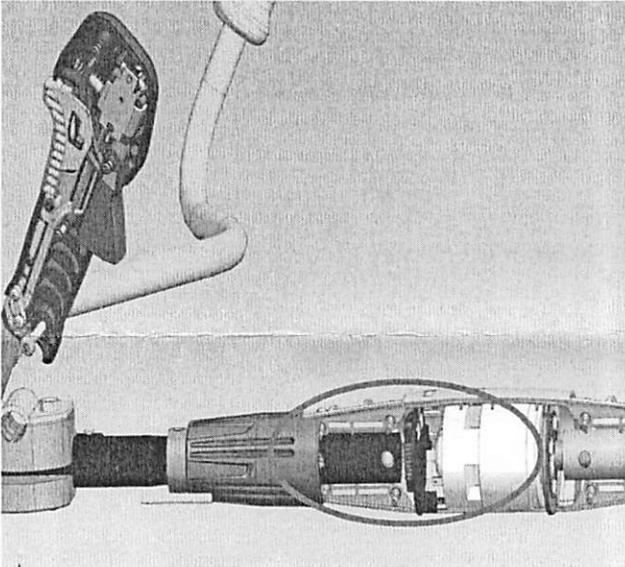
5131042254
DC-Motor 550 Watt

motoruf.de
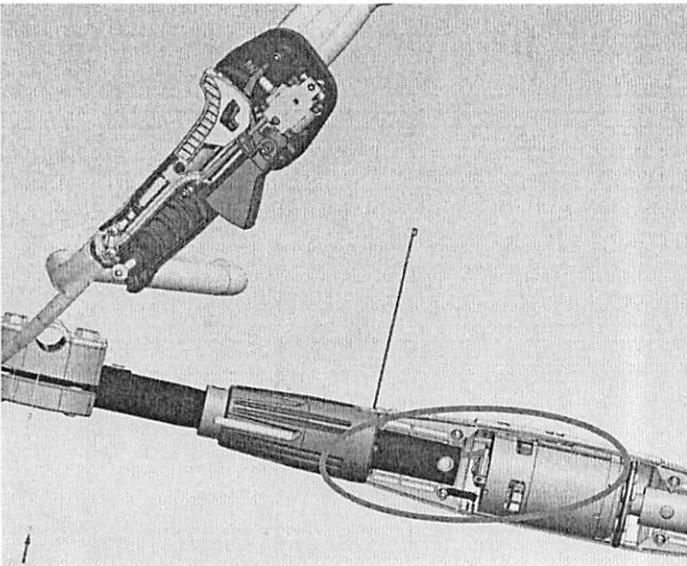

Solution for new Electronic switch repair :

In case of electronical switch **5131035037** exchange,
it's mandatory to use also the new Motor Code **5131041267**
in addition, with the new Housings, **5131035051** & **5131035047**.

Affected Electronic: 5131035037

Old design of Switch directly on the Motor:

New design of switch directly on the Handle and cables to the motor.

Platine entfernen,
ist im neuen
Gehäuse enthalten.